




# SELF INSPECTION SHEET

**CONFIDENTIAL INFORMATION**

This document and the information contemplated therein have to be considered as Confidential Information pursuant to the provisions of Clause 25 of the MSA, and treated as such.

**APPLICATION REFERENCE**

MOUNTING		DESCRIPTION	STATION	CAR TYPE						WORK INSTRUCTION	SAFETY ? 
				TC1	M4	M1	M2	M3	TC2		
<input checked="" type="checkbox"/>	DTR3-PROCE-06	INTERNAL WATERTIGHTNESS	FT1040	1	1	1	1	1	<input checked="" type="checkbox"/>	PRA.FT1040.05.V6	NO
<input type="checkbox"/>											
<input type="checkbox"/>											
<input type="checkbox"/>											
<input type="checkbox"/>											
<input type="checkbox"/>											
<input type="checkbox"/>											
<input type="checkbox"/>											

REV	DATE	MODIFICATION CONTENT	RESPONSIBLE	NAME	DATE
0	7/10/2017	ACCORDING TO IND-SAL-PRS-FRM-022_Rev_04 (LAPA)	APPROVER	THABISO KOMAKO	7/30/2017
			CHECKER	TANUSS MARCONDES	7/30/2017
			COMPILER	SELINA MADINGA	7/10/2017
1	5/26/2020	UPDATED EXPOSURE TIME FROM 20 MINUTES TO 40 MINUTES	APPROVER	VIASHEN SOOBARAMONEY	5/26/2020
			CHECKER	JOSHUA NEMANASHE	5/26/2020
			COMPILER	MUIMELELI TSHITHAVHANA	5/26/2020
2	6/22/2022	REMOVED AIR EXTRACTOR AS PER BASELINE 10.3	APPROVER	COLLINS MBHOMBHI	6/22/2022
			CHECKER	ALLONIA NKONWANA	6/22/2022
			COMPILER	VANESSA NTULI	6/22/2022

TUE	CAR	OPERATOR NAME	DATE	SELF INSPECTION NUMBER	PAGES
T5234	TC2	FIKILE MBONANI	26/06/2024	SI.FT1040.22	01/08



	<h2 style="margin: 0;">SELF INSPECTION INDUSTRIAL QUALITY</h2>	Rev. 02	Project: <b>PRASA</b>	<h1 style="margin: 0;">SI.FT1040.22</h1>
		DATE- 2022/06/22		

	Safety Related	Work station: FT1040
Car:	NCR:	

### I - Documentation and Instruments

#### I.1 - Documentation Control

Document	Type of car						Revision	Obsevation	OK	NOK	Remarks	Signature/Date
	TC1	M1	M2	M3	M4	TC2						
PRA.FT1040.05.V6						X	05	Good	✓		N/A	26/06/2024








#### I.2 - Instruments Control




Monitoring and Measuring Instrument Control - Used for Special Process						
Instruments	Serial number	Calibration or Verification Validation Date		OK	NOK	Signature/Date
PRESSURE GAUGE	N/A	N/A		✓		26/06/2024



### II - Control Activities of Production




#### II.1 - Items to check

Item	Picture/Drawing	Description	Acceptance criteria / Record	OK	NOK	Rework	Signature/Date
01	-	Cleaning the Sector. 5S program up-to-date	The waterproof floor and car floor must be clean. There must be no materials, parts in place that may fall into the tank.	✓			26/06/2024
02	-	<p>Assembly according drawin or complementary documentation apprved by ALSTOM engineering</p> <p>Parameters of the record:</p> <p>1. Water pressure: Specified: Minimum 4 + 1 / -0.5 bar. Found: <u>4,78</u> bar</p> <p>2. Exposure time: Specified: 40 minutes Attendance: <u>20</u> minutes</p>	There is no water retention in the roof or underframe.In any case, it shall be cheched there that exists a clear drainage path on the roof to evacuate the water after the test.	✓			26/06/2024

		<b>SELF INSPECTION INDUSTRIAL QUALITY</b>		Rev. 02 DATE- 2022/06/22	Project: PRASA	<b>SI.FT1040.22</b>	
03	-	<p>After the test check watertightness of the box</p> <p>The box is leakage free? NOTE: If they are detected leakage points the same must be recorded in the table and indicated its location in figures below (Pg 02; 03). Provide the correction of points and then re-test, according To item 5.2 of the Test Procedure. Not occurring points leakage, annul fields of item 11</p>	<p>There is no water retention in the roof or underframe. In any case, it shall be checked there that exists a clear drainage path on the roof to evacuate the water after the test.</p>	✓			 26/06/2024
04	-	<p>Windows</p>	<p>Não deve haver vazamento entre a estrutura e a janela.</p> <p>There must be no water leakage between the structure and the window</p>	✓			 26/06/2024
05	-	<p>Hvac</p>	<p>There must be no water leakage between the structure, supports, corrugation and drains</p>	✓			 26/06/2024
06	-	<p>Sidewall</p>	<p>There must be no water leakage between the structure, window and doors</p>		✓		 26/06/2024
07	-	<p>Roof</p>	<p>There must be no water leakage between the air extractor, corrugation, antennas and passage of cables</p>	✓			 26/06/2024
08	-	<p>End frames</p>	<p>There must be no water leakage between the end frame and gangway.</p>	✓			 26/06/2024


		<b>SELF INSPECTION INDUSTRIAL QUALITY</b>		Rev. 02 DATE- 2022/06/22	Project: PRASA	<b>SI.FT1040.22</b>	
09	-	Cabin junction	There must be no water leakage between the cabin, sidewall and roof	✓			 26/06/2024
10	-	Windscreen	There must be no water leakage between the Windscreen and the mask.	✓			 26/06/2024

		<b>SELF INSPECTION INDUSTRIAL QUALITY</b>		Rev. 02	Project: PRASA	<b>SI.FT1040.22</b>	
				DATE- 2022/06/22			
ITEM	Nº Leakages	Description leakages and correction of action	OK	NO	Notwork	Signature/Date	
11	1	LEAK ON DOOR 5 BOLTS (UPPER GUIDE				 26/06/2024	
		RAIL). CORRECTION ACTION IS TO					
		RESEAL THE BOLTS.					

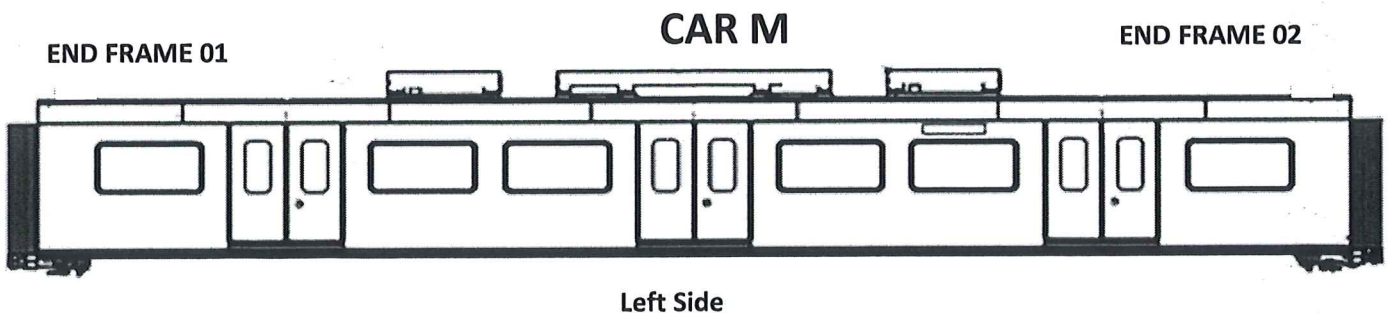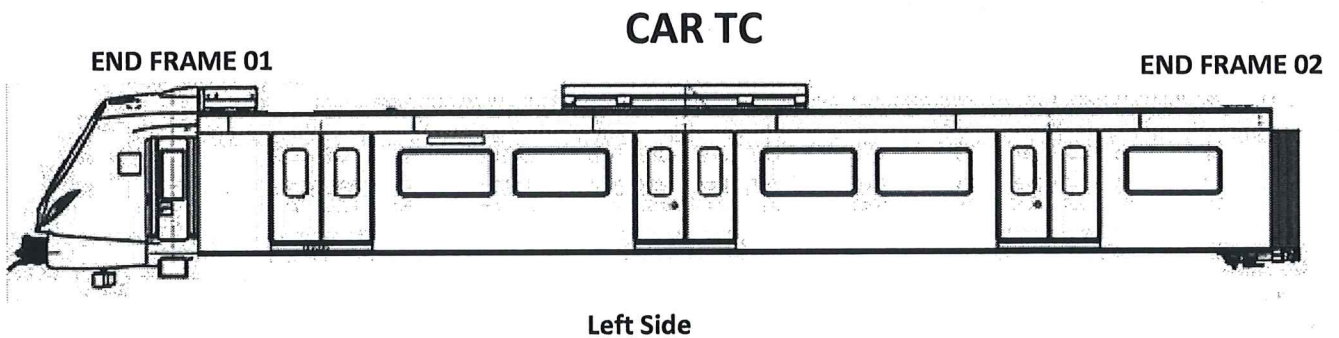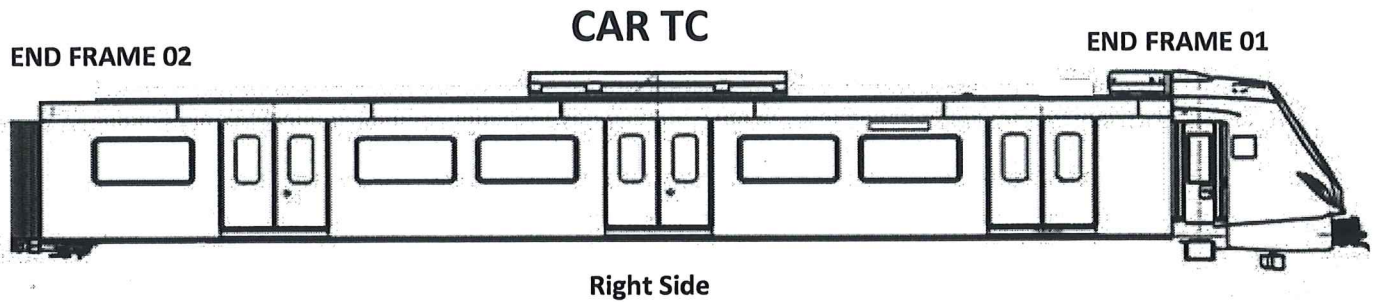





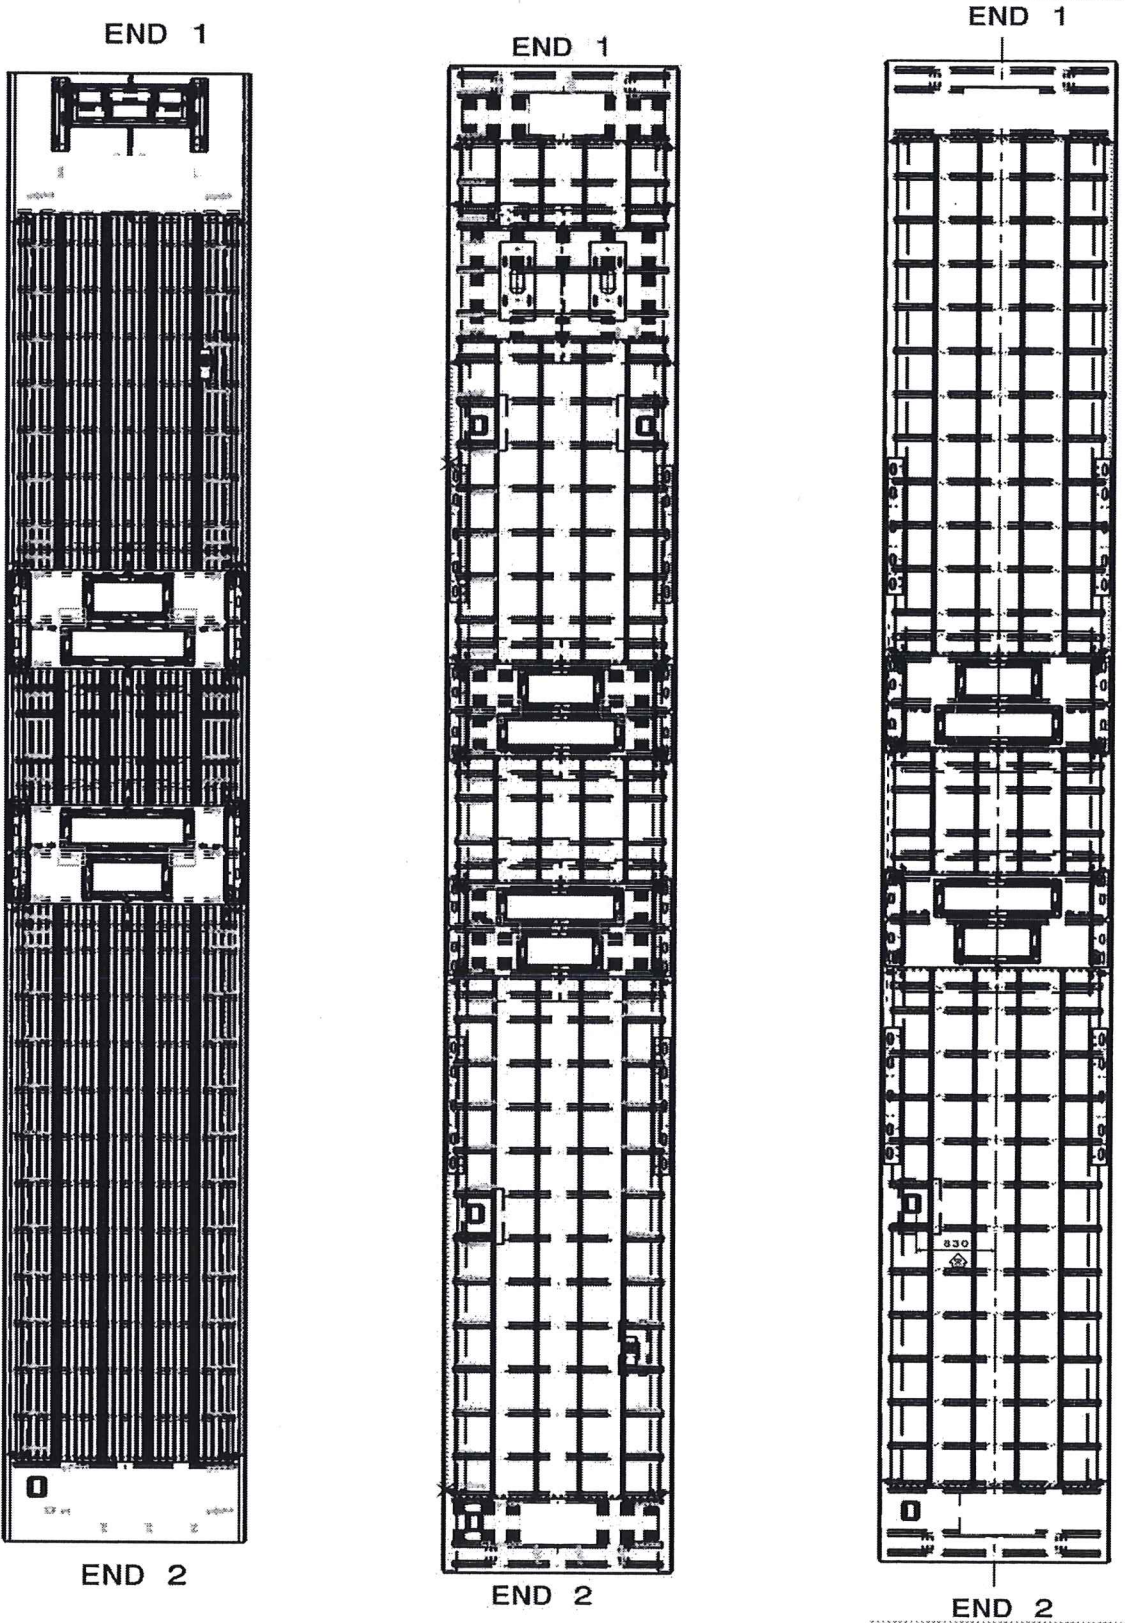


<b>TC</b>	<b>M1 and M2</b>	<b>M3 and M4</b>
-----------	------------------	------------------



Item	Description of the issue	OK	Signature/Date



	<b>SELF INSPECTION INDUSTRIAL QUALITY</b>		Rev. 02	Project: <b>PRASA</b>	<b>SI.FT1040.22</b>	
			DATE- 2022/06/22			
<b>Self Inspection - Final Result</b>						
Is the car good to advance to the next workstation? (Required the approval of EPU Manager and Quality Control)			DATE	NAME	SIGNATURE	
HOLD POINT		GO	If activities are not complete, the missing activities must not impact the next stage!	26/06/2024	Operations Manager Fikile Mbonani	
		GO	(Every auto inspection performed conforms to specification or in case of divergence the same is approved by the competent party.)	26/06/2024	Alloma Industrial Quality	
		NO GO	There are activities pendings that impact/stop the activities of the next process Obs: (To describe problems below)	26/06/2024	Operations Manager Fikile Mbonani	
		NO GO	There are non-conformities impact the quality of the product and there is no corrective action defined yet)	26/06/2024	Alloma Industrial Quality	
In case of "NO GO", describe blocking problems <div style="font-size: 1.1em; margin-top: 5px;">             leak on door 5 upper clanking Rails           </div>						
In case of "NO GO", the operations manager must define below action plan to ensure "GO":						
Item	Description	Action	Responsible	Due Date	Status	
1	Upper rails leading	remove detached sealant and re-apply	Eddie and William	26/06/24	GO - closed	

Operations Manager/ Team Leader

Quality Manager/ Team Leader